



Polyflor Australia Fire Certificates for NCC 2022 Specification 7 C3 Compliance

Polyflors' products are manufactured and tested in the UK.

Polyflor has gone to great lengths to have the UK laboratory, Shirley Technologies Limited, Wira House BCTC, UKAS accredited to perform the fire test required by the Australian NCC, AS ISO 9239.1-2003.

In the Schedule 1 Definitions section of the NCC 2022, an Accredited Testing Laboratory means—

(a) an organisation accredited by the National Association of Testing Authorities (NATA) to undertake the relevant tests; or

(b) an organisation outside Australia accredited to undertake the relevant tests by an authority recognised by NATA through a mutual recognition agreement;

Polyflors' test certificates comply with definition (b). NATA is a signatory of ILAC (International Laboratory Accreditation Cooperation), a Mutual Recognition Program where international accreditation programs, like NATA, are recognised as similar acceptable quality standards.

UKAS is also a signatory and results obtained by a UKAS certified lab are recognised by NATA under this ILAC-MRA agreement.

The laboratory Polyflor uses, BCTC, is UKAS certified to perform AS ISO 9239.1-2003. This compliance is available via their website and is also stamped on the report.

Regarding terminology, in the definitions section of the NCC, *Critical radiant flux means the critical heat flux at extinguishment as determined by AS ISO 9239.1.*

The *smoke development rate* as required under Specification 7 Clause 3 is determined from the AS ISO 9239.1 test method and is by measurement of the smoke obscuration over time. This is expressed as Smoke Obscuration % x minutes.

The AS ISO test method has been copied from International Standards and hence the reason why the difference in terminology to the NCC.

The supplied fire certificate is acceptable in Australia as it is the Australian test performed by a NATA recognised certified laboratory for compliance to NCC 2022 S7C3.



Confidential Report

Our Ref: 26/02007B/02/16

Notified Body
for PPE Directive,
Construction Products
Regulation & Marine
Equipment Directive
I.D. No. 0338 & 0339

British Carpet Technical Centre
Wira House, West Park Ring Road,
Leeds, LS16 6QL

Tel No: +44 (0)113 2591999



17 March 2016

Our Ref: 26/02007B/02/16
Your Ref:

Page 1 of 4

Client: Polyflor Ltd
PO Box 3
Radcliffe New Road
Whitfield
Manchester
M45 7NR

Job Title: **Fire Test on One Sample of Vinyl Flooring**

Clients Order Ref: 2217302

Date of Receipt: 24 February 2016

Description of Sample: One sample of vinyl flooring , referenced:-

Product Name: Polysafe Apex
Nominal Thickness: 2.5
Weight per unit Area kg/m²: 3.15
Batch No: 1D661
Shade: **4202 Chromite**

Work Requested: BCTC were requested to carry out a fire test on the sample supplied to AS ISO 9239-1.



BCTC
CARPET TECHNICAL CENTRE

British Carpet Technical Centre
Wira House
West Park Ring Road
Leeds, LS16 6QL
England

Tel: +44 (0)113 259 1999
Web: <http://www.btg.co.uk>
Email: CSLeeds@btg.co.uk

17 March 2016

Page 2 of 4

Our Ref: 26/02007B/02/16
Your Ref:

Polyflor Ltd

FIRE TESTS ACCORDING TO AS ISO 9239-1:2003
Reaction to fire tests for Floorings - Part 1: Determination of the burning behaviour using a radiant heat source (ISO 9239-1:2002)

Date of Test: 15/03/2016

Conditioning

The specimens were conditioned in accordance with BS EN 13238:2002. The substrate used was a fibre cement board (ISO 390) with a thickness of (6 ± 1) mm and a density of $(1,800\pm 200)$ Kg/m³ representing the standard substrate of Class A1fl or A2fl.

Procedure

The test was carried out in accordance with AS ISO 9239-1. The sponsor sampled and cut the specimens to the dimensions stated.

Specimens were individually placed in the combustion chamber and allowed to preheat for two minutes under a radiant panel, which gives an imposed radiant flux ranging from approximately 11.0 kW/m² to 1.0 kW/m² along the specimen.

The pilot flame used was the line burner as described and was applied to the surface of the specimen for 10 minutes and then removed.

The flame front was measured at the end of the test or at 30 minutes if applicable.

Test termination was considered to be when the flame front self extinguished or at 30 minutes, whichever is the sooner.

The heat flux from the panel incident on the specimen when self extinguished or at 30 minutes (critical heat flux CHF or HF-30) was calculated from a prior calibration.





17 March 2016

Page 3 of 4

Our Ref: 26/02007B/02/16
Your Ref:

Polyflor Ltd

Results

The test results relate to the behaviour of the test specimens of a material under the particular conditions of test; they are not intended to be the sole criterion for assessing the full potential fire hazard of the materials in use.

<u>Specimen No.</u>	<u>Direction of spec.</u>	<u>Smoke Obscuration</u>		<u>Maximum Flame front (mm)</u>	<u>Heat Flux-30 (HF-30) (kW/m²)</u>	<u>Critical Heat Flux (CHF) (kW/m²)</u>	<u>Duration of Flaming (sec)</u>
		<u>Max %</u>	<u>% x min</u>				
1	Machine	59	213	110	--	10.8	724
2	Across	66	235	120	--	10.6	732
3	Across	52	166	115	--	10.7	723
4	Across	61	224	140	--	10.2	726
Mean of 3 specs.	Across	60	208	125	--	10.5	727

<u>Distance Burnt (mm)</u>	<u>Time for each specimen to burn (s)</u>			
	<u>1</u>	<u>2</u>	<u>3</u>	<u>4</u>
50	132	136	150	140
100	187	185	221	207

Note

One specimen was initially tested in each direction and whichever direction gave the worst result a further two specimens were tested. Only the results of the 3 specimens in the same direction were used to calculate the mean results.

The specimens of floor covering were tested adhered to a 6mm fibre cement board , as defined in BS EN 13238:2010 using Ball F44 Adhesive.





BCTC
CARPET TECHNICAL CENTRE

British Carpet Technical Centre
Wira House
West Park Ring Road
Leeds, LS16 6QL
England

Tel: +44 (0)113 259 1999
Web: <http://www.btg.co.uk>
Email: CSLeeds@btg.co.uk

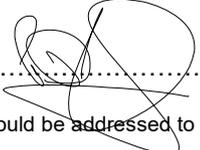
17 March 2016

Page 4 of 4

Our Ref: 26/02007B/02/16
Your Ref:

Polyflor Ltd

Reported by:.....  A Shute, Fire Technician

Countersigned by:.....  P Doherty, Operational Head

Enquiries concerning this report should be addressed to Customer Services.

